


GENERALSCAN

GS V20

Digital Tape Measure

QUICK START GUIDE

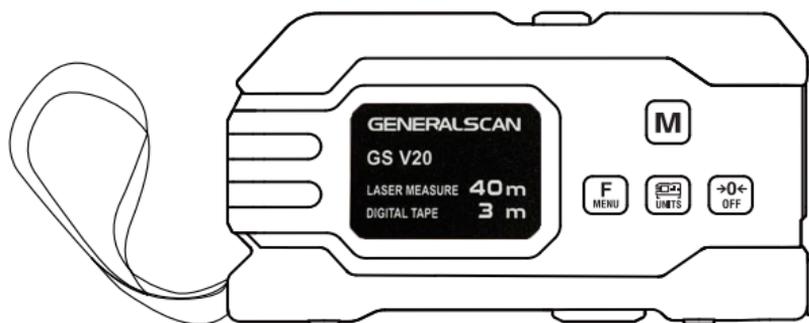

EN

■ GENERALSCAN QUICK START GUIDE

This guide introduces the basic using method and the basic parameters of digital tape Bluetooth measure GS V20, you can adjust the settings of your device according to your wishes and get it work easily. If any further questions, please contact us via email support@generalscan.cloud.

■ COPYRIGHT

GENERALSCAN reserves the right to make changes to any product to improve reliability, function, or design.


GENERALSCAN does not assume any product liability arising out of, or in connection with the application or use of any product, circuit, or application described herein.

■ UNPACKING

1



2





① GS V20 x 1 ② Type-C Cable

■ LASER SAFETY

Do not stare into the laser beam or view directly with optical instruments.



FEATURES

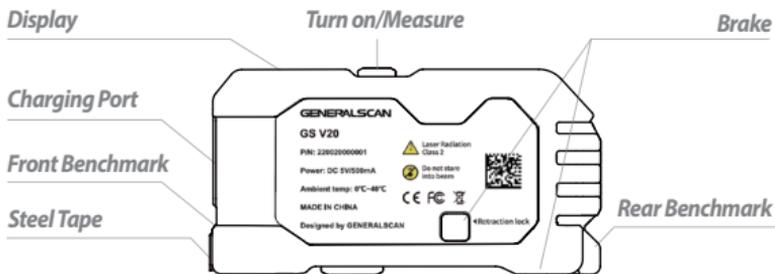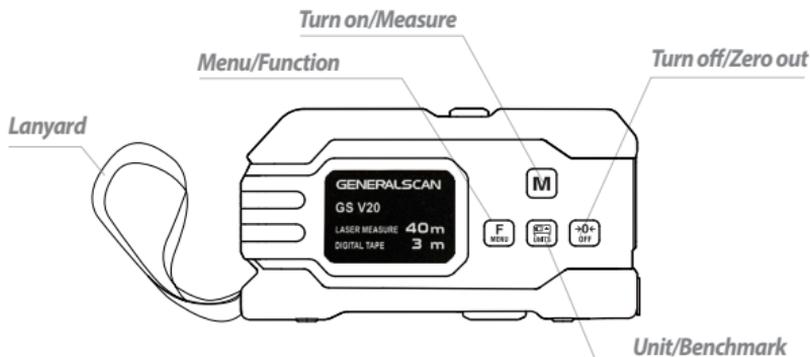

POWER ON AND POWER OFF

Power on

Press **M** for about 3 seconds to turn it on.

Power off

Press **→0- OFF** button for about 3 seconds to turn it off.

■ HOW TO MEASURE

Common Measure

Pull out the steel tape to start measure directly. Short press **M** to confirm the measurement data.

Laser Measure

The steel tape at zero position, long press **M** to enter into laser continuative measure mode, short press again the **M** to exit laser continuative measure mode.

The steel tape at zero position, short press **M** to enter into laser measure mode, short press again the **M** to record the measurement data.

When measuring in the functional mode, short press **→0← OFF** to return to the previous step of measurement.

■ SWITCH MEASURE MODE

Short press **F MENU** to switch length measurement, area measurement, volume measure, Pythagorean measurement, and horizontal measurement.



Length Measure



Area Measure



Volume Measure



Pythagorean Measure



Pythagorean Measure

SWITCH BENCHMARK

Short press  to switch front benchmark and rear benchmark. The benchmark icon will stay on the left above corner.

 shows in display when it is in front benchmark state.

 shows in display when it is in the state of rear benchmark.

SWITCH UNIT

Long press  to switch mm, cm, m, Inchx0.1, FTx0.01, and Inchx1/16&FT. The unit icon will be shown on the display at the right bottom corner.

ZERO OUT

Short press  to forcibly clear the current measurements.

MENU OPERATION

Menu Function

Button	Function	
	Short Press	Long Press
	Page Up	
	Confirm Data	Enter the Menu Page
	Page Down	
	Return to previous Menu	

■ INQUIRY MEASURE HISTORY

 In this page, short press  to enter into history inquiry page, short press  or  to page up or page down.

■ INQUIRY DEVICE INFORMATION

 In this page, short press  to check the detailed information about the device.

■ OPEN OR CLOSE VOICE

 In this page, short press  to enter into selection page, short press  or  to open or close voice. Short press  to confirm open or close voice.

■ SCREEN ROTATION

 In this page, short press  to enter into the selection page, short press  or  to confirm the orientation of screen. Short press  to confirm the orientation.

■ SOFTWARE DOWNLOAD

Please download the software from our website **www.generalscan.cloud** to record and transfer the measurement data.

Service Information

If you have a question of your GENERALSCAN barcode scanner, please visit our service page for assistance.

www.generalscan.cloud/services

QUICK USER GUIDE

Email: Support@generalscan.cloud

©2023 GENERALSCAN All rights reserved

Version 1.1



886783026001